# **O1** SCREW JACKS










DISTRIBUIDOR MEX (55) 53 63 23 31 MTY (81) 83 54 10 18 AUTORIZADO QRO (442) 1 95 72 60 ventas@industrialmagza

# **"THERE IS A DRIVING FORCE MORE POWERFUL THAN STEAM, ELECTRICITY AND ATOMIC ENERGY: THE WILL."**

### ALBERT EINSTEIN PHYSICIST

NIASA ACTUATORS IN THE TONOPAH THERMO-SOLAR PLANT, NEVADA, USA.

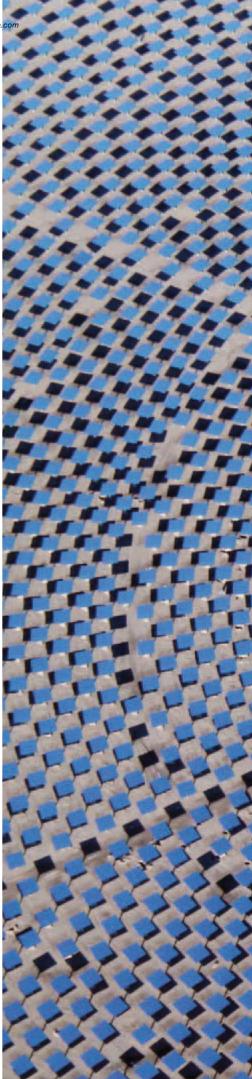

) Solar Reserve





... ...

# SCREW JACKS

NIASA N/W/R Series screw jacks are a combination of a screw with a gearbox. There are three types of configurations that can be adapted to different requirements:

- ... N: The screw moves when the gearbox input shaft (worm shaft end) is activated. It includes a rounded screw protection tube on the back.
- ... **W**: The screw engages, as in configuration N but with the difference that the back protective tube is square section, which means it can be an anti-rotating screw.
- ... **R**: The screw does not move with the driving of the worm shaft, it only turns; it is the corresponding nut that moves along the screw.

In applications that so require, there is a possibility to protect the screw with a bellow (available in different materials), to protect it in the outside environment and make the screw jacks suitable for outdoor operations or environments with a certain atmospheric aggressiveness.

Screw jacks are often the most optimal technical and economical solution for applications that require lineal, precise and safe movement, for transfer and for elevation, mainly for medium-heavy loads and medium-low speeds.

Their main advantages against other systems, such as pneumatic or hydraulic cylinders, are the following:

- ... Greater movement and positioning precision.
- ... Greater safety, due to their irreversibility in many configurations (ask NIASA) and/or the incorporation of different braking devices.
- ... Superior energy efficiency, as their parts offer high/very high performance, especially with the ball screws, low transmission ratios and high speeds
- ... Easier and faster assembly, since hydraulic or pneumatic groups are not required, just an electric motor on the unit itself.
- ... Greater reliability and duration, and less maintenance, due to the mechanical robustness and construction simplicity.
- ... Modular design and the possibility of operating in multiple positions.
- ... Easier to obtain synchronised advance movements of several screw jacks, including under different loads.
- ... Lower size for the same load capacity.

... ...


The screw jacks also characterised for offering an extensive range of:

- ... Axial load capacities, from 5 kN up to 500 kN.
- ... Advance speeds, depending on the screw pitch and the gearbox, two possible gears are offered depending on the size of the screw jack, from 4:1 to 56:1.
- ... Trapezoidal and ball screws, depending on the performance required, precision of movement and positioning, etc.
- Fastening accessories and elements, for optimal adaptation to the most varied systems that may be designed.
- ... Control and safety systems (mechanical/inductive limit switches, absolute/incremental encoders, etc.).
- ... Materials and surface coverings, depending on the environmental conditions in which the unit will be installed.

Please do not hesitate to contact NIASA if you require screw jacks (and their drive mechanisms) with specifications other than those covered in this chapter. The NIASA technical department will specifically develop the special units that best meet your requirements.





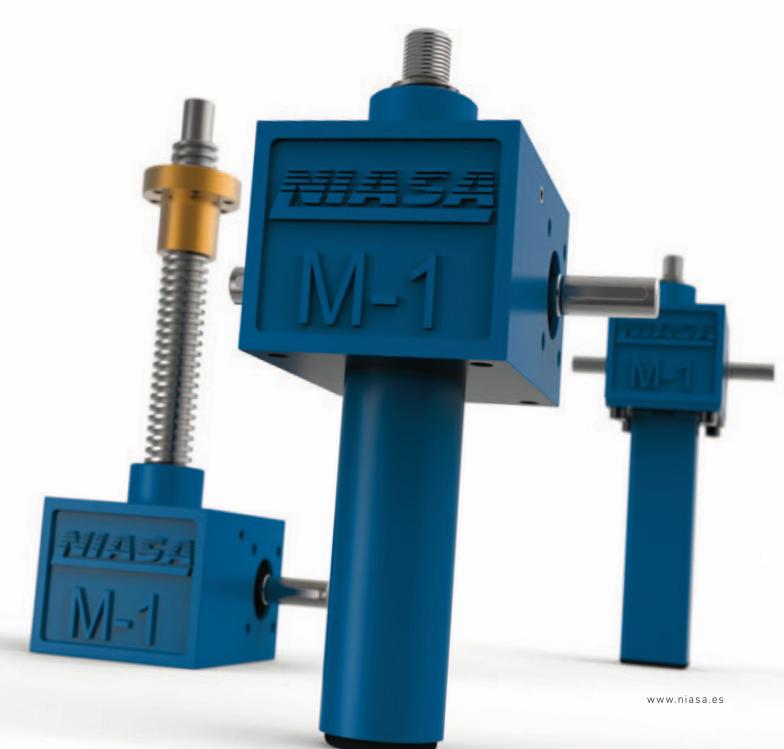



# SCREW JACKS APPLICATIONS

### **MACHINE TILTING SYSTEM**

Set of two M4-N screw jacks made up of a three-phase motor drive system and joined together with a GX universal joint shaft. Tilt on the top of the gearbox with a ZKM joint adapter, SB tip supports, GKB series double clevis rod, FB protective bellow, inductive sensor and electro-magnetic brake.

### MANUAL POSITIONING SYSTEM.

Set of three M2-N screw jacks made up of a manual drive system with a VE series wheel and joined together with GX universal joint shafts. LCM-series mounting feet underneath the box, GKB series double clevis rod, manual brake and analogue odometer.



DISTRIBUIDOR MEX (55) 53 63 23 31 MTY (81) 83 54 10 18 AUTORIZADO QRO (442) 1 95 72 60 ventas@industrialmagza.com

### **PHOTOVOLTAIC INSTALLATION**

M5-W screw jack with IPX protection for outdoor weather made up of a three-phase motor drive system, tilt underneath the gearbox with a ZKM joint adapter, clevis rod with GIR series ball joint on the screw, EPDM special protection bellow and inductive sensor.

### PLATFORM ELEVATION SYSTEM.

Set of four M5-N screw jacks made up of a three-phase motor drive system and joined together with EZ universal joint shafts and bevel gearboxes. LCM-series mounting feet underneath the box, BPS flange fastening on the screw, FB series protective bellow and PR series worm shaft protector.

### TILTING ELEVATION SYSTEM


Set of two M5-N screw jacks made up of a dual-shaft three-phase motor drive system and joined together with GX universal joint shafts. Tilt underneath the gearbox with a ZKM joint adapter, SB tilt supports, clevis rod with GIR series ball joint on the screw, FB special protective bellow, and PR series worm shaft protector.






# SCREW JACKS SIZES

On all the sizes there are trapezoidal and screw drive options (see chapter 07 for further information), as well as normal speed (S) and reduced speed (H) gearboxes.

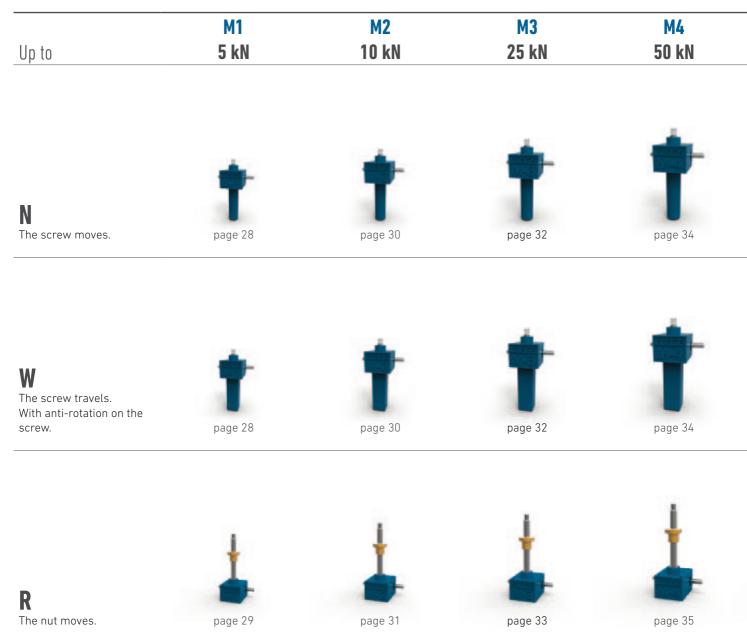

In addition to the standard range of screw jacks, NIASA can specifically develop the unit that best meets your application requirements. Contact NIASA.




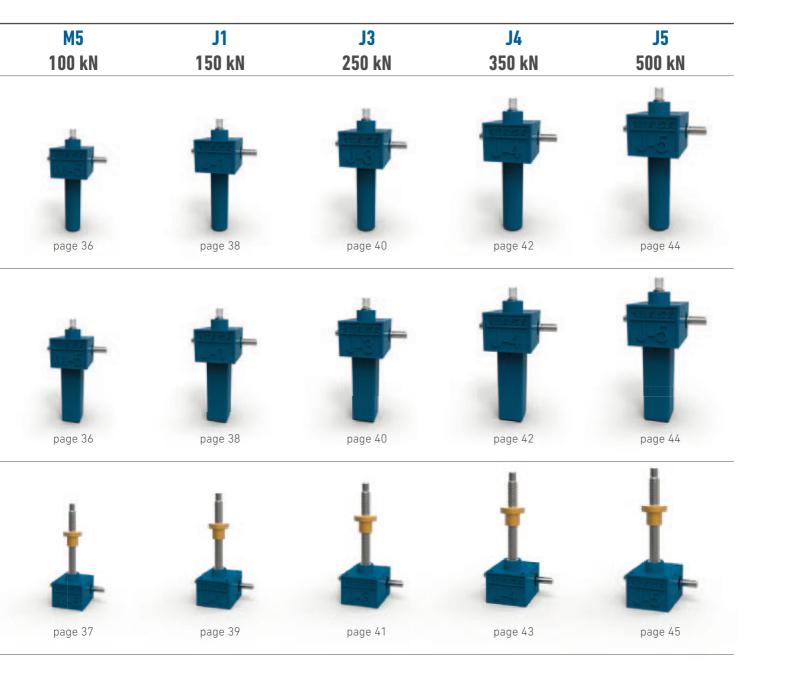





# SCREW JACKS GENERAL PRODUCT OVERVIEW

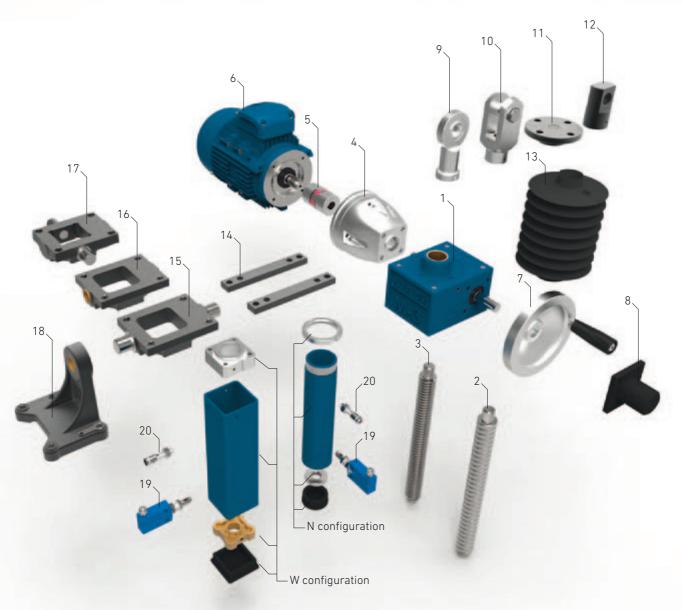

# N/W

Name	Page
01 M series box	24
02 Ball screw	28
03 Trapezoidal screw	28
04 Motor flange	
05 EK coupling	284
06 Motorization	312
07 Wheel with VE grip	300
08 PR worm gear protector	304

09 GIR clevis rod	282
10 GKB double clevis rod	281
11 BPS flange	278
12 GKS single clevis rod	280
13 FB protector bellow	301
14 LCM mounting feet	266
15 Flange with ZKM bolts	267
16 Flanges with ZKH bearings	268

17	Flange with ZKV 90° bolts	269
18	SB tilt supports	276
19	FCM mechanical limit switch	307
20	FCI inductive limit switch	306



 DISTRIBUIDOR
 MEX (55) 53 63 23 31
 MTY (81) 83 54 10 18

 AUTORIZADO
 QRO (442) 1 95 72 60
 ventas@industrialmagza.com





Name	Page
01 M series box	24
02 Ball screw	29
03 Trapezoidal screw	29
04 Motor flange	
05 EK coupling	284
06 Motorization	312
07 Wheel with VE grip	300
08 PR worm gear protector	304


09	KGM nut	248
10	KGF nut	246
11	Flange with BPR bearing	279
12	EFM nut	258
13	EFM safety nut	258
14	FB protector bellow	301
15	SF protector bellow	302
16	LCM mounting feet	266

-		
17	HFM ball joint	270
18	Flange with ZKM bolts	267
19	Flanges with ZKH bearings	268
20	Flange with ZKV 90° bolts	269
21	SB tilt supports	276
22	Flange with KAR bolts	275



The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request.


120

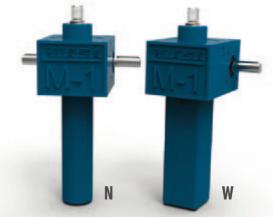

MEX (55) 53 63 23 31 MTY (81) 83 54 10 18

QRO (442) 1 95 72 60 ventas@industrialmagza.com

DISTRIBUIDOR

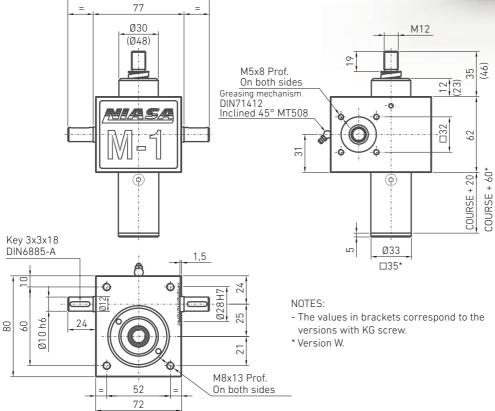

Screw	Maximum	Reduction		Reduction		Reduction		Reduction		Reduction		Reduction		Reductior			avel Trevol.	Perfor (%		Drive torqu	ue, M <sub>p</sub> (Nm)	Start-up M <sub>o</sub> (	o torque, Nm)	Weight	Approx. weight
diameter and pitch	axial strength	input)					(0)	F (kN	stroke 0 (kg)	each 100mm															
(mm)	(kN)	S H S H		Н	S	Н	S	Н	S	Н	(	of stroke (kg)													
Tr 18x4	5	4:1	16:1	1	0.25	36	28	(0.44xF)+0.08	(0.14xF)+0.06	0.66xF	0.27xF	1.2	0.26												
KGS 1605	5	4:1	16:1	1.25	0.31	79	62	(0.25xF)+0.08	(0.08xF)+0.06	0.32xF	0.13xF	1.3	0.26												

... Power required:  $P_{D}$  (kW) = 0.157 x  $M_{D}$  (Nm).

... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).








DISTRIBUIDOR MEX (55) 53 63 23 31 MTY (81) 83 54 10 18 QRO (442) 1 95 72 60 ventas@industrialmagza.com



The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request.

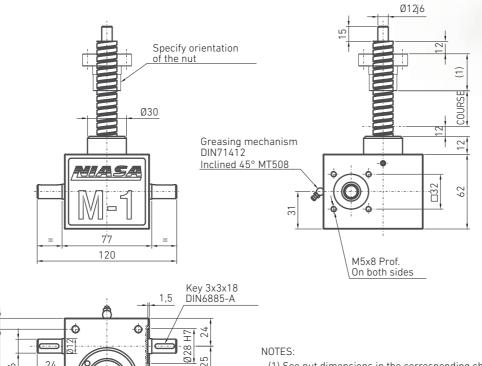

0

Ò

52

72

21

M8x13 Prof.

On both sides

- (1) See nut dimensions in the corresponding chapter.

Screw	axial	Reduction		Reduction			avel /revol.		mance	Drive torqu	ue, M <sub>p</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
diameter and pitch	strength	axial input)					%)	F (kN		stroke 0 (kg)	each 100mm				
(mm)	(kN	S H S H		Н	S	Н	S	Н	S	Н	(itg)	of stroke (kg)			
Tr 18x4	5	4:1	16:1	1	0.25	36	28	(0.44xF)+0.08	(0.14xF)+0.06	0.66xF	0.27xF	1.2	0.20		
KGS 1605	5	4:1	16:1	1.25	0.31	79	62	(0.25xF)+0.08	(0.08xF)+0.06	0.32xF	0.13xF	1.3	0.20		

... Power required:  $P_{D}$  (kW) = 0.157x  $M_{D}$  (Nm).

24


Ó


Ø10 h6

80 90

... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).



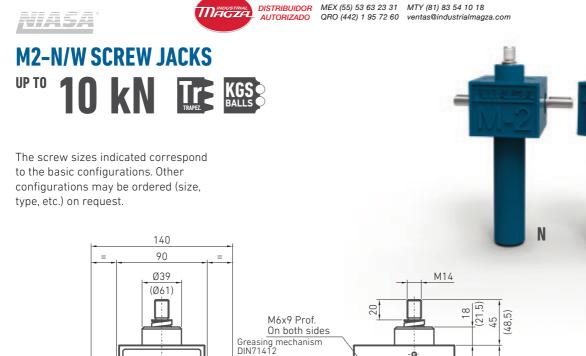

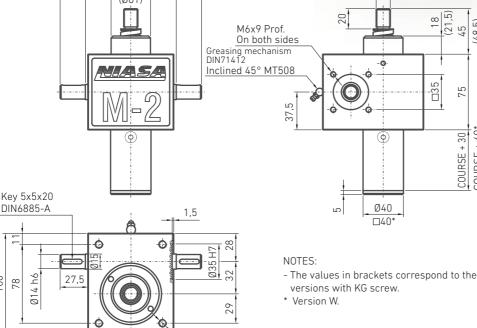

M8x15 Prof.

On both sides

Screw	Maximum			Reduction		Reduction		Reduction		Reduction		Reduction		Reduction		Reduction			avel /revol.		mance	Drive torqu	ie, M <sub>D</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
diameter and pitch	meter axial I pitch strength					(*	%)	F (kN), load to move in dynamic				stroke 0 (kg)	each 100mm														
(mm)	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(	of stroke (kg)														
Tr 20x4	10	4:1	16:1	1	0.25	34	27	(0.47xF)+0.22	(0,15xF)+0.14	0.72xF	0.28xF	2.1	0.55														
KGS 2005	10	4:1	16:1	1.25	0.31	80	64	(0.25xF)+0.22	(0.08xF)+0.14	0.32xF	0.12xF	2.3	0.55														

... Power required:  $P_{p}$  (kW) = 0.157x  $M_{p}$  (Nm).

=

63

85

DIN6885-A

Ø14 h6

100 78

... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).

... Ensure that the dynamic load of the application does not surpass the critical values indicated, in order to avoid overheating of the unit and buckling and resonance of the screw. See calculations chapter (page 48).




W

22

COURSE + 30



The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request.

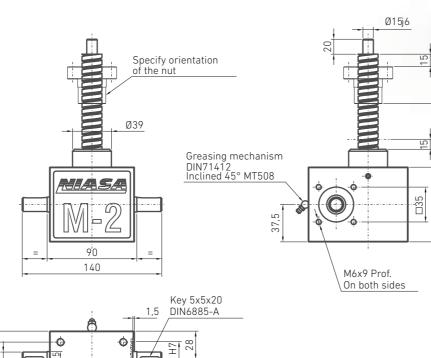

Ø35 H

32

29

M8x15 Prof.

On both sides

C

à

63

85



01

NOTES: - (1) See nut dimensions in the corresponding chapter.

Ξ

COURSE

ω

75

QRO (442) 1 95 72 60 ventas@industrialmagza.com

	diameter axial	Maximum	Reduction			avel /revol.		mance	Drive torqu	ue, M <sub>p</sub> (Nm)		o torque, Nm)	Weight	Approx. weight	
and pi	neter axial ir pitch strength					out)	(:	%)	F (kN		stroke 0 (kg)	each 100mm			
(mn	(mm) (kN)	(mm)	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	( <u>)</u>	of stroke (kg)
Tr 20	)x4	10	4:1	16:1	1	0.25	34	27	(0.47xF)+0.22	(0,15xF)+0.14	0.72xF	0.28xF	2.1	0.42	
KGS 2	005	10	4:1	16:1	1.25	0.31	80	64	(0.25xF)+0.22	(0.08xF)+0.14	0.32xF	0.12xF	2.3	0.42	

... Power required:  $P_{D}$  (kW) = 0.157x  $M_{D}$  (Nm).

27,5

Ó


100

h6 78

Ø14 h

... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).



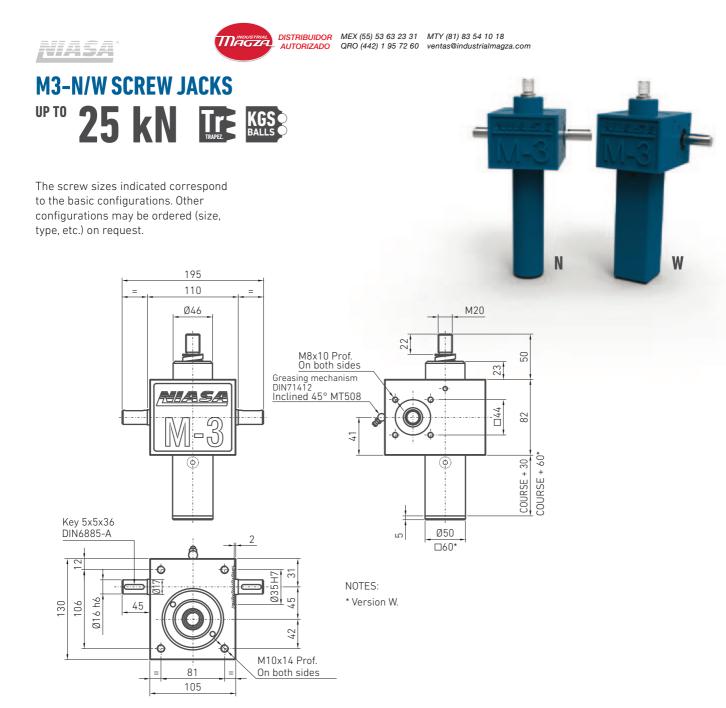


Screw	Maximum axial	Red	luction		avel /revol.		mance	Drive torqu	ue, M <sub>D</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
diameter and pitch		input)		(%)		F (kN	stroke 0 (kg)	each 100mm					
(mm) (kN)	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(itg)	of stroke (kg)
Tr 30x6	25	6:1	24:1	1	0.25	34	27	(0.47xF)+0.3	(0,15xF)+0.24	0.72xF	0.31xF	6	1.68
KGS 2505	12	6:1	24:1	0.83	0.21	81	64	(0.16xF)+0.3	(0.05xF)+0.24	0.21xF	0.09xF	7	1.68

... Power required:  $P_{D}$  (kW) = 0.157x  $M_{D}$  (Nm). ... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 48).





The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request.

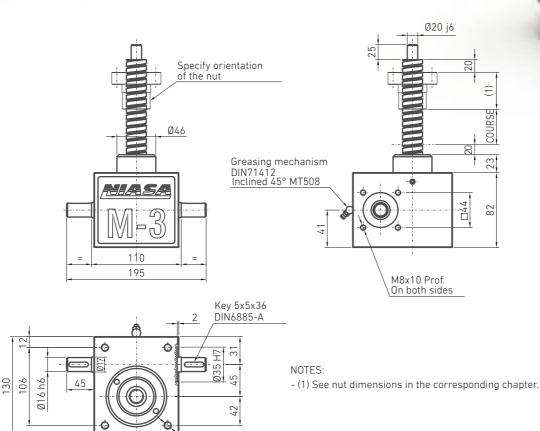


M10x14 Prof.

On both sides

MEX (55) 53 63 23 31 MTY (81) 83 54 10 18

QRO (442) 1 95 72 60 ventas@industrialmagza.com

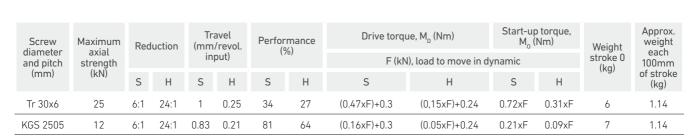

... Power required:  $P_{D}$  (kW) = 0.157x  $M_{D}$  (Nm).

81

105

=


... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 48).

... Ensure that the dynamic load of the application does not surpass the critical values indicated, in order to avoid overheating of the unit and buckling and resonance of the screw. See calculations chapter (page 48).



R

01

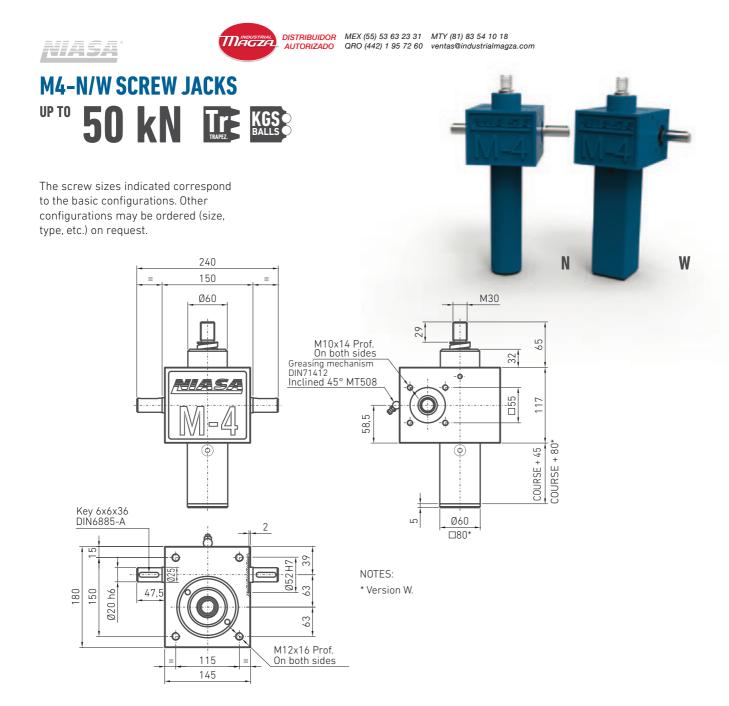

Screw Maximum diameter axial		Reduction			avel /revol.		mance	Drive torqu	ie, M <sub>D</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
and pitch	strength	input)				6	%)	F (kN	F (kN), load to move in dynamic				each 100mm
(mm)	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(kg)	of stroke (kg)
Tr 40x7	50	7:1	28:1	1	0.25	32	26	(0.51xF)+0.7	(0,15xF)+0.5	0.84xF	0.33xF	17	2.65
KGS 4005	22	7:1	28:1	0.71	0.18	81	67	(0.14xF)+0.7	(0.04xF)+0.5	0.18xF	0.07xF	19	2.65
KGS 4010	42	7:1	28:1	1.43	0.36	81	67	(0.28xF)+0.7	(0.09xF)+0.5	0.37xF	0.15xF	19	2.65

... Power required:  $\rm P_{_{D}}$  (kW) = 0.157x  $\rm M_{_{D}}$  (Nm).

... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).






 DISTRIBUIDOR
 MEX (55) 53 63 23 31
 MTY (81) 83 54 10 18

 AUTORIZADO
 QRO (442) 1 95 72 60
 ventas@industrialmagza.com



The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request.

NIASA

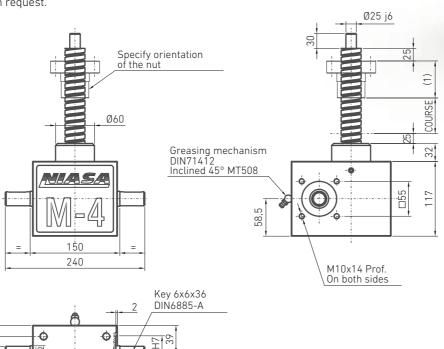

052

63

M12x16 Prof.

On both sides

C

Ø



01

NOTES: - (1) See nut dimensions in the corresponding chapter.

Screw	Maximum	Red	luction		avel /revol.	Perfor		Drive torqu	ie, M <sub>D</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
(mm)	axial strength			in	put)	(%	0)	F (kN	), load to move in d	ynamic		stroke 0 (kg)	each 100mm
	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(rg)	of stroke (kg)
Tr 40x7	50	7:1	28:1	1	0.25	32	26	(0.51xF)+0.7	(0,15xF)+0.5	0.84xF	0.33xF	17	1.67
KGS 4005	22	7:1	28:1	0.71	0.18	81	67	(0.14xF)+0.7	(0.04xF)+0.5	0.18xF	0.07xF	19	1.67
KGS 4010	42	7:1	28:1	1.43	0.36	81	67	(0.28xF)+0.7	(0.09xF)+0.5	0.37xF	0.15xF	19	1.67

... Power required:  $P_{D}$  (kW) = 0.157x  $M_{D}$  (Nm).

025

Ó

=

 $\odot$ 

115

145

47,5


150 h6

Ø20

180

... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).



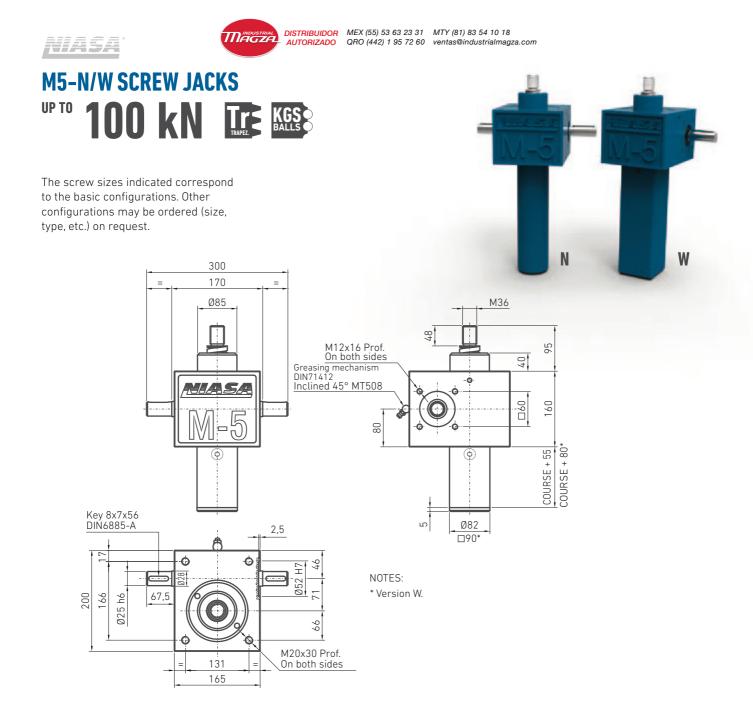


Screw	Maximum	Red	uction		l (mm/		mance	Drive torqu	ue, M <sub>p</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
diameter and pitch	axial strength			revol.	input)	(	%)	F (kN	), load to move in d	ynamic		stroke 0 (kg)	each 100mm
(mm)	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(rg)	of stroke (kg)
Tr 55x9	100	9:1	36:1	1	0.25	30	24	(0.54xF)+1.68	(0.17xF)+1.02	0.88xF	0.36xF	32	4.12
KGS 5010	65	9:1	36:1	1.11	0.28	81	65	(0.22xF)+1.68	(0.07xF)+1.02	0.29xF	0.12xF	35	4.12

... Power required:  $P_{D}$  (kW) = 0.157x  $M_{D}$  (Nm). ... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).





The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request.

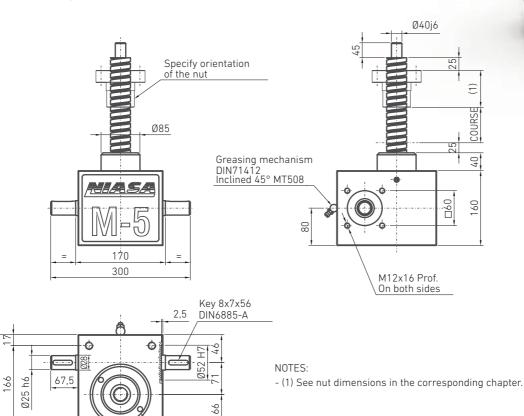

Screw	Maximum	Red	uction		avel /revol.		mance %)	Drive torqu	ie, M <sub>p</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
diameter	axial strength			in	put)	()	70)	F (kN	), load to move in d	ynamic		stroke 0 (kg)	each 100mm
(mm)	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(	of stroke (kg)
Tr 55x9	100	9:1	36:1	1	0.25	30	24	(0.54xF)+1.68	(0.17xF)+1.02	0.88xF	0.36xF	32	3.04
KGS 5010	65	9:1	36:1	1.11	0.28	81	65	(0.22xF)+1.68	(0.07xF)+1.02	0.29xF	0.12xF	35	3.04

MEX (55) 53 63 23 31 MTY (81) 83 54 10 18

QRO (442) 1 95 72 60 ventas@industrialmagza.com

... Power required:  $P_{p}$  (kW) = 0.157x M<sub>p</sub> (Nm).

-Ô

131

165

-

Ó

M20x30 Prof.

On both sides


... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).

... Ensure that the dynamic load of the application does not surpass the critical values indicated, in order to avoid overheating of the unit and buckling and resonance of the screw. See calculations chapter (page 48).



R

200

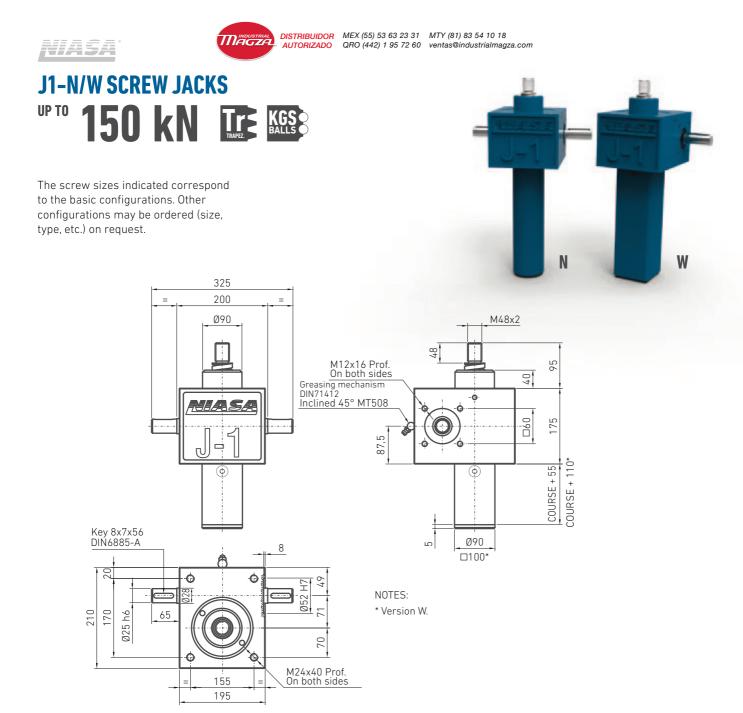

Screw	Maximum	Red	uction		avel /revol.		mance %)	Drive torqu	ie, M <sub>p</sub> (Nm)	Start-up M <sub>o</sub> (	o torque, Nm)	Weight	Approx. weight
diameter and pitch (mm)	axial strength			in	put)	(.	/0)	F (kN	), load to move in d	ynamic		stroke 0 (kg)	each 100mm
	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(	of stroke (kg)
Tr 60x9	150	9:1	36:1	1	0.25	28	21	(0.57xF)+1.8	(0.19xF)+1.15	0.88xF	0.36xF	41	4.3

... Power required:  $P_{D}$  (kW) = 0.157x  $M_{D}$  (Nm).

... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).





 DISTRIBUIDOR
 MEX (55) 53 63 23 31
 MTY (81) 83 54 10 18

 AUTORIZADO
 QRO (442) 1 95 72 60
 ventas@industrialmagza.com





The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request.

-

NIASA

R

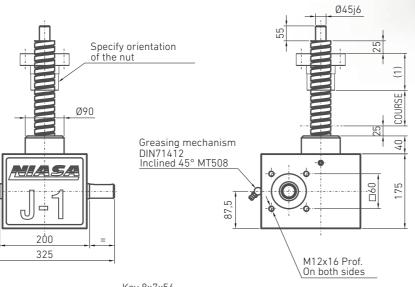

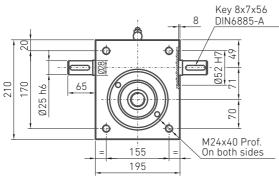


NOTES: - (1) See nut dimensions in the corresponding chapter.

Screw	Maximum	Red	uction		avel /revol.		mance %)	Drive torqu	ue, M <sub>D</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
diameter and pitch (mm)	axial strength (kN)	S	Н	in S	put) H	5	H	F (kN	I), load to move in d H	ynamic S	Н	stroke 0 (kg)	each 100mm of stroke
		0		0		0		J		0			(kg)
Tr 60x9	150	9:1	36:1	1	0.25	28	21	(0.57xF)+1.8	(0.19xF)+1.15	0.88xF	0.36xF	41	3.1

... Power required:  $\rm P_{_{D}}$  (kW) = 0.157x  $\rm M_{_{D}}$  (Nm).

... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).



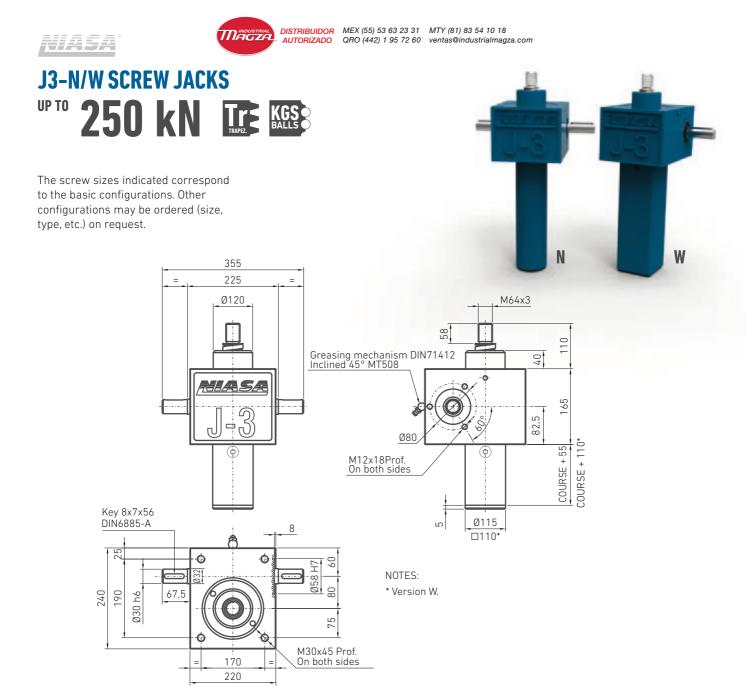

Screw	Maximum	Red	uction		avel /revol.		mance	Drive torqu	ue, M <sub>D</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
diameter and pitch	axial strength			in	put)	()	%)	F (kN	I), load to move in d	ynamic		stroke 0 (kg)	each 100mm
(mm)	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(rtg)	of stroke (kg)
Tr 80x10	250	10:1	40:1	1	0.25	24	21	(0.65xF)+2.6	(0.19xF)+1.9	0.94xF	0.33xF	57	7.8
KGS 8010	78	10:1	40:1	1	0.25	81	69	(0.2xF)+2.6	(0.06xF)+1.9	0.22xF	0.08xF	63	7.8


... Power required:  $P_{p}$  (kW) = 0.157x  $M_{p}$  (Nm).


... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).





The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request.

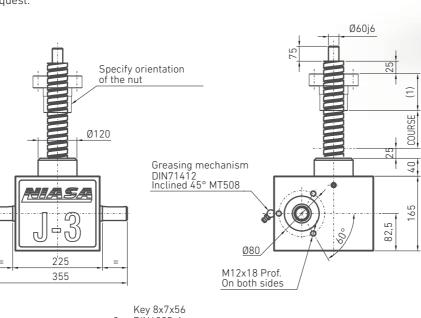

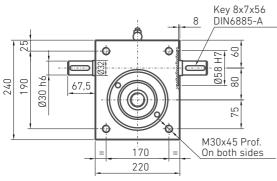

#### NOTES: - (1) See nut dimensions in the corresponding chapter.

QRO (442) 1 95 72 60 ventas@industrialmagza.com

Screw	Maximum	Red	uction		avel /revol.		mance	Drive torqu	ue, M <sub>D</sub> (Nm)		o torque, Nm)	Weight	Approx. weight
diameter and pitch (mm)	axial strength			in	put)	(	%)	F (kN	I), load to move in d	ynamic		stroke 0 (kg)	each 100mm
	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(itg)	of stroke (kg)
Tr 80x10	250	10:1	40:1	1	0.25	24	21	(0.65xF)+2.6	(0.19xF)+1.9	0.94xF	0.33xF	57	6.13
KGS 8010	78	10:1	40:1	1	0.25	81	69	(0.2xF)+2.6	(0.06xF)+1.9	0.22xF	0.08xF	63	6.13

... Power required:  $P_{D}$  (kW) = 0.157x  $M_{D}$  (Nm).


... All the data in the table correspond to an input speed of 1,500 rpm. For other speeds, please see the calculation chapter (page 47).

... Ensure that the dynamic load of the application does not surpass the critical values indicated, in order to avoid overheating of the unit and buckling and resonance of the screw. See calculations chapter (page 48).



01

R

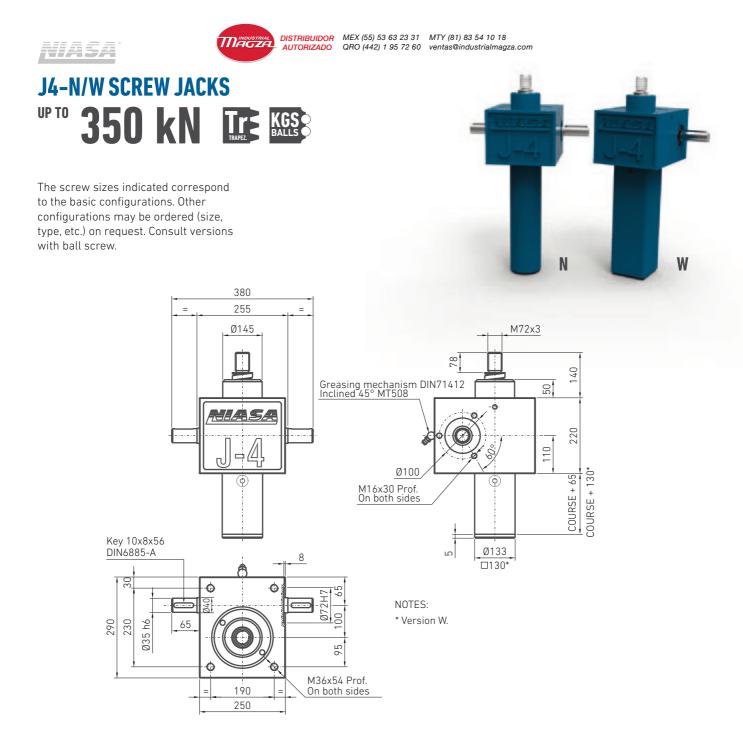

Screw	Maximum axial	Red	uction		l (mm/ input)		mance %)	Drive torqu	ie, M <sub>p</sub> (Nm)	Start-up M <sub>o</sub> (I		Weight	Approx. weight
diameter and pitch (mm)	strength			Tevol.	input/	1.	/0)	F (kN	), load to move in d	ynamic		stroke 0 (kg)	each 100mm
	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	(	of stroke (kg)
Tr 100x10	350	10:1	40:1	1	0.25	21	18	(0.77xF)+3.2	(0.22xF)+2.2	1.22xF	0.4xF	85	9.8

... Power required:  $\mathrm{P}_{_{\mathrm{D}}}$  (kW) = 0.157x  $\mathrm{M}_{_{\mathrm{D}}}$  (Nm).

... All the data in the table correspond to an input speed of 1,000 rpm. For other speeds, please see the calculation chapter (page 47).







 DISTRIBUIDOR
 MEX (55) 53 63 23 31
 MTY (81) 83 54 10 18


 AUTORIZADO
 QRO (442) 1 95 72 60
 ventas@industrialmagza.com



R

J4-R SCREW JACKS UP TO 350 kN FREE RGS RALLS

The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request. Consult versions with ball screw.

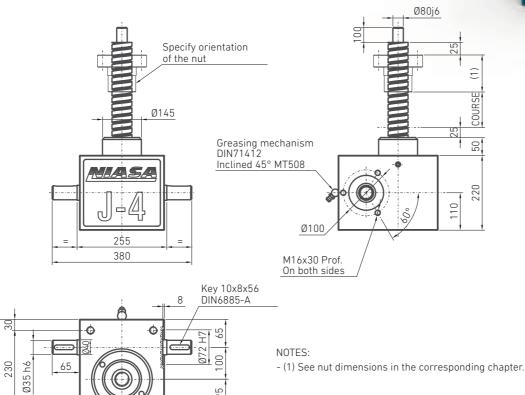

95				
M36x54 Prof.				
On both sides				

Screw	Maximum	Red	uction		avel /revol.		rmance %)	Drive torqu	ie, M <sub>p</sub> (Nm)	Start-up M <sub>o</sub> (		Weight	Approx. weight
diameter and pitch (mm)	axial strength			in	put)	(	70)	F (kN	), load to move in d	ynamic		stroke 0 (kg)	each 100mm of stroke
(11111)	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н	, , , , , , , , , , , , , , , , , , ,	(kg)
Tr 100x10	350	10:1	40:1	1	0.25	21	18	(0.77xF)+3.2	(0.22xF)+2.2	1.22xF	0.4xF	85	7.9

... Power required:  $\rm P_{_{D}}$  (kW) = 0.157x  $\rm M_{_{D}}$  (Nm).

Ó

Q

190


250

... All the data in the table correspond to an input speed of 1,000 rpm. For other speeds, please see the calculation chapter (page 47).

... Ensure that the dynamic load of the application does not surpass the critical values indicated, in order to avoid overheating of the unit and buckling and resonance of the screw. See calculations chapter (page 48).



290

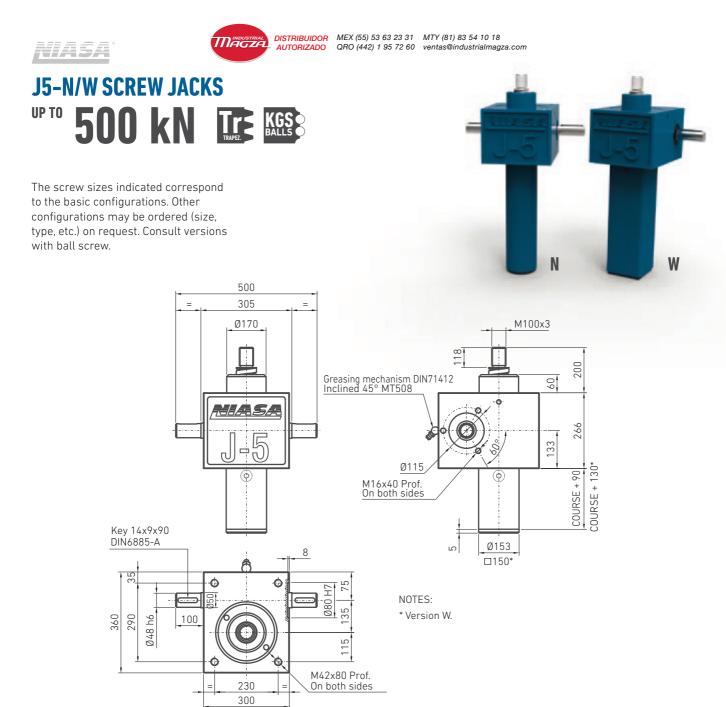

Screw diameter	Maximum axial	Red	uction		avel /revol.		rmance %)	Drive torqu	ue, M <sub>p</sub> (Nm)	Start-up M <sub>o</sub> (		Weight	Approx. weight
and pitch	strength			in	put)	(.	/0)	F (kN	I), load to move in d	ynamic		stroke 0 (kg)	each 100mm of stroke
(mm)	(kN)	S	Н	S	Н	S	Н	S	Н	S	Н		(kg)
Tr 120x14	500	14:1	56:1	1	0.25	24	20	(0.67xF)+4	(0.2xF)+2.9	0.99xF	0.4xF	160	13.8

... Power required:  $P_{p}$  (kW) = 0.157x  $M_{p}$  (Nm).

... All the data in the table correspond to an input speed of 1,000 rpm. For other speeds, please see the calculation chapter (page 47).







 DISTRIBUIDOR
 MEX (55) 53 63 23 31
 MTY (81) 83 54 10 18


 AUTORIZADO
 QRO (442) 1 95 72 60
 ventas@industrialmagza.com




R

J5-R SCREW JACKS UP TO 500 kN FREE KGS BALLS

The screw sizes indicated correspond to the basic configurations. Other configurations may be ordered (size, type, etc.) on request. Consult versions with ball screw.

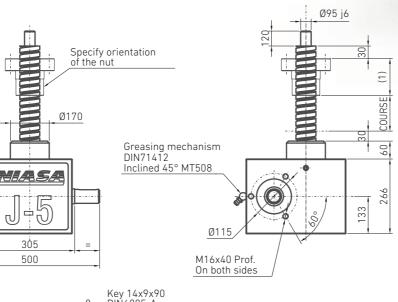

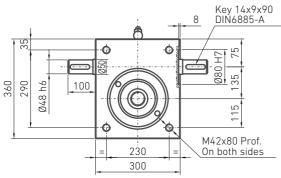

### NOTES: - (1) See nut dimensions in the corresponding chapter.

Screw	Maximum axial	Red	uction	(mm	avel /revol.		mance %)	Drive torqu	ue, M <sub>p</sub> (Nm)	Start-up M <sub>o</sub> (	o torque, Nm)	Weight	Approx. weight
diameter and pitch (mm)	strength (kN)			in	put)	(.	/0)	F (kN	), load to move in d	ynamic		stroke 0 (kg)	each 100mm of stroke
(11111)	(KIN)	S	Н	S	Н	S	Н	S	Н	S	Н		(kg)
Tr 120x14	500	14:1	56:1	1	0.25	24	20	(0.67xF)+4	(0.2xF)+2.9	0.99xF	0.4xF	160	11.5

... Power required:  $P_{D}$  (kW) = 0.157x  $M_{D}$  (Nm).

... All the data in the table correspond to an input speed of 1,000 rpm. For other speeds, please see the calculation chapter (page 47).






To select the correct screw jack, please follow this flow diagram.

If you would like to know the expected service life of a unit for your application, please send the relevant data to the NIASA service department.






DISTRIBUIDOR MEX (55) 53 63 23 31 MTY (81) 83 54 10 18 AUTORIZADO QRO (442) 1 95 72 60 ventas@industrialmagza.com

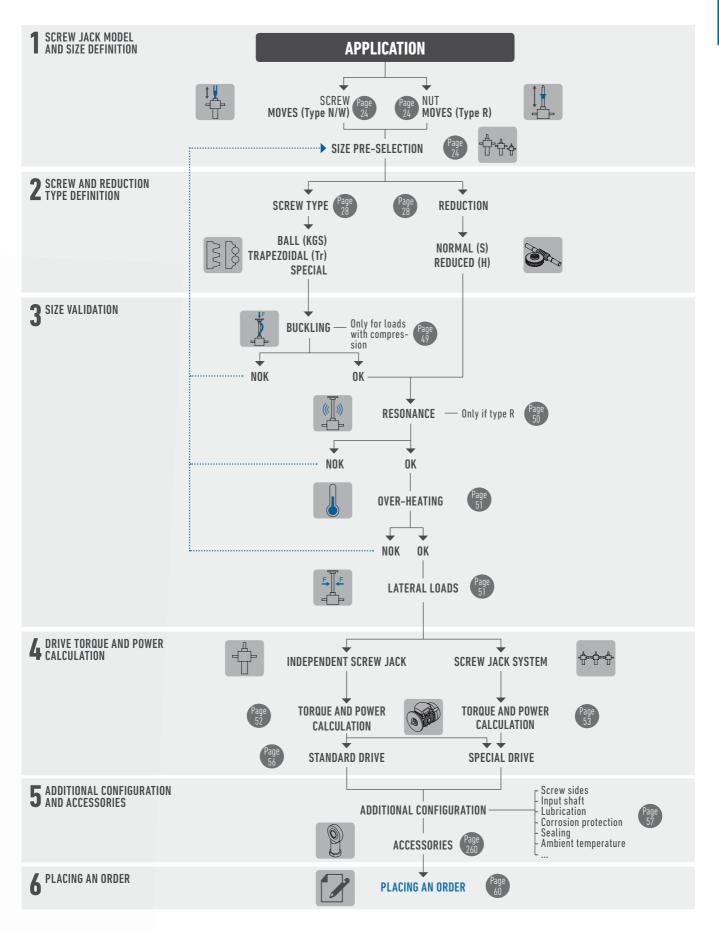




### FORCE AND TORQUE ACTING ON A SCREW JACK

- **F** Load to move at traction and/or compression.
- **F**<sub>L</sub> Lateral load on the screw.
- $\bar{\boldsymbol{V}}$  Travel speed of the screw or the nut.
- **F**<sub>A</sub> Axial load on the input shaft.
- $\mathbf{F}_{\mathbf{R}}$  Radial load on the input shaft.
- $M_{\rm p}$  Torque on the input shaft.
- **n** Speed on the input shaft.
- n<sub>s</sub> Screw turning speed.

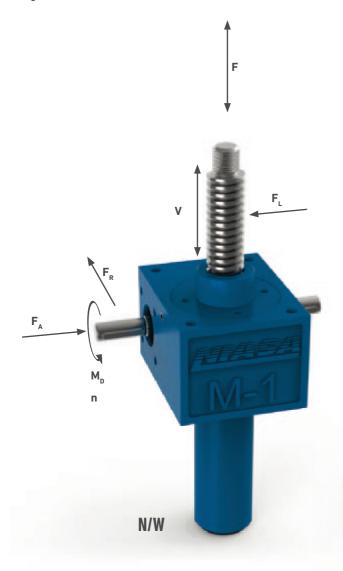

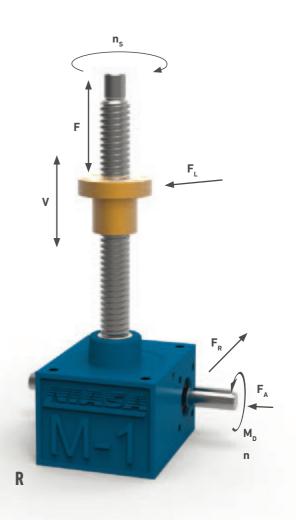



## CRITICAL COMPRESSION BUCKLING LOAD OF A SCREW JACK

When there are compression loads on the screw, it may fail due to buckling, before reaching its static load capacity.

If the critical compression buckling load calculated is lower than the actual compression buckling load applied, a screw jack with a larger diameter screw must be selected and its suitability checked.

Check it using the following steps:

#### 1. COMPRESSION BUCKLING LENGTH AND CORRECTOR FACTOR

Select the length L (mm) and the factor K, to be considered in the buckling critical load calculation. Do this based on the type of support on the sides of the screw jack, according to the figures shown on the right.

#### 2. BUCKLING CRITICAL LOAD


 $F_{crit}$  (kN)= 33,91 ×  $\frac{d^4}{(K \times L)^2}$ 


- d Screw core diameter (mm).
- L Buckling length (mm).
- K Length corrector factor.


#### IMPORTANT


- ... In general, the load applied on the screw jack, including possible impacts, must not surpass the calculated value.
- ... The safety factor considered is 3; reconsider this if so considered opportune for the specific application. As a recommendation, when a hypothetical screw jack failure may involve injuries to people, multiply the critical load calculated by an additional factor of 0.6 (final safety factor, 5).
- **d** Screw core diameter (mm).

Trapezoidal screw (Tr)												
18x4	20x4	30x6	40x7	55x9	60x9	80x10	100x10	120x14				
13	14.5	22.3	31.2	44	49	67.9	87.9	103.5				
Ball screw (KGS)												
1605	2	005	2505	400	)5	4010	5010	8010				
12.9	1	6.9	21.9	36	.9	34.1	44.1	74.1				

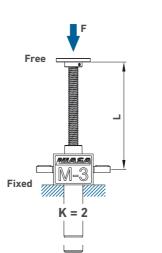

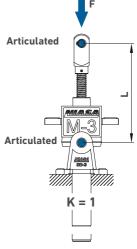

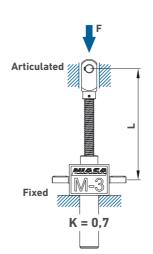

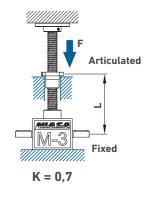



### **CRITICAL RESONANCE SPEED OF A SCREW JACK**

Applicable to the R version (the screw rotates and the nut moves).

With reduced diameter and long length screws, there is a risk of having considerable vibration on turning if this occurs at speeds close to the first vibration frequency (the second and highest correspond to very high speeds, at which the screws never work). In the worst cases, the screw may break and, additionally, the risk of collapse due to side buckling considerably increases.

For these reasons, be sure that the screw jack screw works at considerably lower rotation speeds than resonance speeds. If not, select a screw of a larger diameter and/or reduce its turning speed and/or modify the screw jack end supports.

#### **1. LENGTH, RESONANCE AND CORRECTOR FACTOR**

Select the length L and the correction factor M to consider. Do this based on the types of supports on the sides of the screw jack, according to the figures shown on the right.

#### 2. MAXIMUM ADMISSIBLE SPEED


 $n_{adm}$  (rpm)= M ×  $\frac{d}{L^2}$  × 10<sup>8</sup>


- d Screw core diameter (mm).
- $\label{eq:last} \textbf{L} \quad \text{Length between supports (mm)}.$
- **M** Corrector factor according to supports.

#### IMPORTANT

- ... The safety factor considered is 1.25 (maximum admissible speed = 80% of the critical resonance speed).
- d Screw core diameter (mm)


Trapezoidal screw (Tr)											
18x4	20x4	30x6	40x7	55x9	60x9	80x10	100x10	120x14			
13	14.5	22.3	31.2	44	49	67.9	87.9	103.5			
Ball screw (KGS)											
1605	j 2	005	2505	400	)5	4010	5010	8010			
12.9		6.9	21.9	36.	.9	34.1	44.1	74.1			

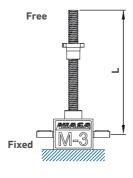


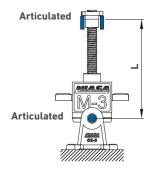



M = 0,97

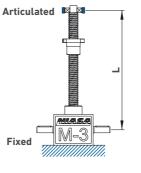

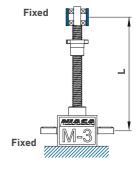

M = 1,51

M = 2,19

Page: 051


- ... If it is essential that the screw jack is subject to lateral loads, please contact the NIASA design department for correct design of the unit.
- ... This includes the horizontal mountings, on which the screw can flex when subject to the action of its own weight.

## **LATERAL LOAD OF A SCREW JACK**

NIASA recommends that, if they exist, the lateral loads on the screw must be supported by guide systems designed for this purpose, in addition to the guide for the gearbox, so that the screw or the nut exclusively support axial traction/ compression loads.

If there are side loads, the life of the screw jack will be notably reduced, as there will be premature wear of the screw and the nut, which is often the origin of faults.

#### IMPORTANT

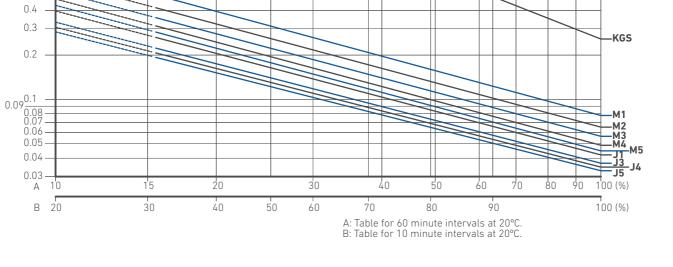

If it does not comply, choose a larger screw jack and/or reduce the load and/or reduce the speed.

### **OVERHEATING OF A SCREW JACK**

DISTRIBUIDOR

AUTORIZADO

These ft values correspond to configuration N. For configuration H, multiply by 2.

**NAGZA** 

MEX (55) 53 63 23 31 MTY (81) 83 54 10 18

QRO (442) 1 95 72 60 ventas@industrialmagza.com

With the aim of avoiding overheating due to internal friction of the screw jacks, the axial strength and the advance speed must be controlled. To do this, check the unit selected with the following formula.

For very small strokes, please contact the NIASA technical department.



- F Axial strength on the screw (kN).
- V Advance speed of the screw (mm/min).
- Fmax Axial load capacity of the screw jack (kN).
- Temperature factor, according to the diagram. f.

$$V_{max} V_{max} \left(\frac{mm}{min}\right) = 1.500 \left(\frac{1}{min}\right) x advance \left(\frac{mm}{rev}\right)$$

For input speeds over 1,500 rpm, please contact the NIASA technical department.

# **SCREW JACKS PRODUCT SELECTION**

**f** 0.9<u>1</u>.0 0.8 0.7 0.6 0.5





## DRIVE TORQUE AND POWER OF AN INDEPENDENT SCREW JACK

After pre-selecting the suitable screw jack for the application, select the drive motor, following the steps below.

#### **1. DRIVE TORQUE**

$$M_{\rm p}(\rm Nm) = \frac{F \times P}{2 \times \pi \times \eta_{\rm pg} \times \eta_{\rm ps} \times i} + M_{\rm p}$$

- F Load to elevate in dynamic (kN)
- P Screw pitch (mm)
- **M**, Idle torque (Nm)
- i Screw jack gearbox
- **n**<sub>pg</sub> Gearbox dynamic efficiency
- $\eta_{\rm DS}$  Screw dynamic efficiency

#### 2. POWER REQUIRED

$$P_{D}(kW) = \frac{M_{D} \times n}{9550}$$

M<sub>p</sub> Drive torque (Nm)

n Screw jack input speed (rpm)

#### IMPORTANT

- ... In general, it is advisable to multiply the power value calculated for a safety coefficient of 1.3 to 1.5; or for small installations, a factor of 2.
- ... When the load to move is lower than 10% of the elevator's nominal load, consider that value for the previous calculations.

#### **3. START-UP TORQUE**

For loads between 25% and 100% of the screw jack's nominal value, calculate the start-up torque with this formula:

$$M_{D}(Nm) = \frac{F \times P}{2 \times \pi \times \eta_{sA} \times i}$$

**η<sub>sA</sub>** Screw jack static efficiency (gearbox + screw)

#### IMPORTANT

... For loads under 25% of the screw jack's nominal value, select the start-up torque by multiplying the drive torque by 2.

#### $\eta_{ng}$ Gearbox dynamic efficiency

rpm	S version (normal speed)											
input	M1	M2	M3	M4	M5	J1	J3	J4	J5			
3,000	0.91	0.9	0.92			Non-st	andard					
1,500	0.88	0.89	0.9	0.9	0.9	0.9	0.9	Non- da				
1,000	0.87	0.88	0.88	0.88	0.87	0.89	0.89	0.9	0.91			
<u>    1,000    </u> 750	0.87 0.85	0.88	0.88 0.87	0.88 0.87	0.87 0.86	0.89	0.89	0.9	0.91 0.91			
									-			
750	0.85	0.87	0.87	0.87	0.86	0.88	0.89	0.9	0.91			

rpm	H version (reduced speed)											
input	M1	M2	M3	M4	M5	J1	J3	J4	J5			
3,000	0.75	0.77	0.76			Non-st	andard					
1,500	0.69	0.71	0.71	0.74	0.72	0.68	0.77		stan- Ird			
1,000	0.67	0.69	0.68	0.69	0.67	0.67	0.76	0.77	0.75			
750	0.64	0.66	0.67	0.68	0.65	0.65	0.75	0.77	0.74			
500	0.61	0.64	0.63	0.64	0.62	0.64	0.74	0.76	0.72			
100	0.54	0.56	0.54	0.55	0.53	0.55	0.66	0.69	0.62			

#### $\eta_{\scriptscriptstyle DS}$ Screw dynamic efficiency

Trapezoidal screw (Tr)									
18x4 20x4 30x6 40x7 55x9 60x9 80x10 100x10 120x14									
0.41	0.38	0.38	0.35	0.33	0.31	0.27	0.23	0.26	
Ball screw (KGS)									
			0.0	? (for al	l sizes)				

#### M, Idle Torque

S version (normal speed)								
M1	M2	М3	M4	M5	J1	J3	J4	J5
0.08	0.22	0.3	0.7	1.68	1.8	2.6	3.2	4
H version (reduced speed)								
M1	M2	М3	M4	M5	J1	J3	J4	J5
0.06	0.14	0.24	0.5	1.02	1.15	1.9	2.2	2.9

#### $\eta_{sa}$ Screw jack static efficiency

	S version (normal speed)									
	M1	M2	M3	M4	M5	J1	J3	J4	J5	
Trapez.	0.24	0.22	0.22	0.19	0.18	0.18	0.17	0.13	0.16	
Balls	0.63	0.63	0.63	0.62	0.61	0.65	0.71	0.68	0.7	
			(reduced speed)							
	M1	M2	M3	M4	M5	J1	J3	J4	J5	
Trapez.	0.15	0.14	0.13	0.12	0.11	0.11	0.12	0.1	0.1	
Balls	039	N 41	0.39	039	0.36	Π4	05	0 51	Ω44	

#### IMPORTANT

- ... The values indicated in the tables correspond to the lubrication conditions established by NIASA, for gearbox and screw, and will be reached after a small period of operation.
- ... In the case of low temperatures, these can be reduced considerably.

### NIASA





# SCREW JACKS PRODUCT SELECTION


# PLANNING INSTALLATIONS WITH SCREW JACKS

For the application of screw jacks in installations with several units, the following criteria must be taken into account:

- 1. Define the number, position and orientation of the screw jacks.
- **2.** Select the drag components (couplings, transmission shafts, supports, bevel gearboxes, motors, etc.) taking the following recommendations into account:
  - ... Ensure that the total load is distributed uniformly between all the installation's screw jacks.
  - ... The lowest possible number of transmission parts is recommended.
  - ... The transmission shafts should be as short as possible.
  - ... Try to protect the overall installation with a safety torque limiter.
- **3.** If during the design of the installation a problem arises in defining the turning sense of the different elements, it is advised to apply the following method:
  - ... Indicate the orientation of the screw jack elements.
  - ... Mark the screw turning sense on each screw jack to "lift".
  - ... Show the position of the bevel gearboxes and the transmission shafts in a diagram.

#### Example:

Elevation system with four screw jacks and two bevel gearboxes.

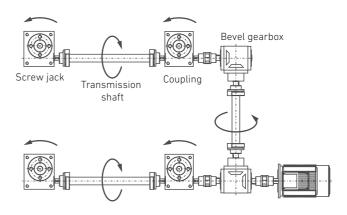






## DRIVE TORQUE OF A SCREW JACK System

The drive torque of a system made up of several screw jacks connected to each other depends on the torque required for the individual drive of each one and the efficiency of the transmission parts that connect them.

#### Example:

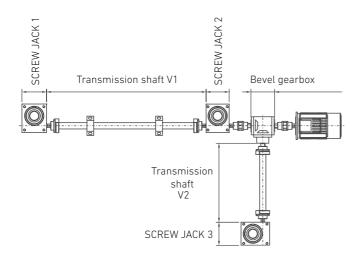

#### **1. SYSTEM DRIVE TORQUE**

$$M_{DS} (Nm) = \frac{M_{D1}}{\eta_{V1}} + M_{D2} + \left(\frac{M_{D3}}{\eta_{V2}} \times \frac{1}{\eta_{k}}\right)$$

${f M}_{_{D1}}/{f M}_{_{D2}}/{f M}_{_{D3}}$ ${f \eta}_{_{V1}}/{f \eta}_{_{V2}}$	Screw jack drive torque 1 / 2 / 3 (Nm) Gearbox efficiency V1 / V2
	(0.90-0.95 approx.)
η <sub>κ</sub>	Distribution gearbox efficiency (0.90 approx.)

#### IMPORTANT

- ... In general, it is advisable to multiply the value calculated for a safety coefficient of 1.3 to 1.5; or for small installations, a factor of 2.
- ... When the load to move is lower than 10% of the elevator's nominal load, consider that value for the previous calculations.

To help the calculation, some frequent arrangements are shown for those for which the system's drive torque can be calculated approximately using the formula below.

It is assumed that the load distribution is uniform between all the units and that they are all the same size.

#### $M_{DS}$ (Nm)= $M_{D} \times f_{S}$

 $\mathbf{M}_{\mathbf{p}}$  Independent screw jack drive torque

 $\mathbf{f_s}^{-}$  Factor, depending on system (see figures next page)

#### 2. SYSTEM START-UP TORQUE

For loads by screw jack between 25% and 100% of the screw jack's nominal value, calculate the start-up torque with this formula:

$$M_{DS}(Nm) = \frac{M_{DS}}{\eta_{SJ}}$$

 $M_{ps}$  System drive torque (Nm)  $\eta_{s1}$  Elevator static efficiency

#### IMPORTANT


... For loads by elevator lower than 25% of its nominal value, multiply the system drive torque by 2.

 DISTRIBUIDOR
 MEX (55) 53 63 23 31
 MTY (81) 83 54 10 18

 AUTORIZADO
 QRO (442) 1 95 72 60
 ventas@industrialmagza.com


<u>fs = 2.25</u>


f<sub>s</sub> = 2.1



 $f_{s} = 3.34$ 

fs = 6.8

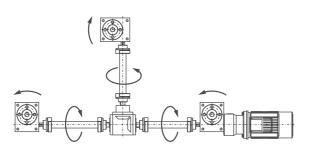





Д

01


f<sub>s</sub> = 2.25

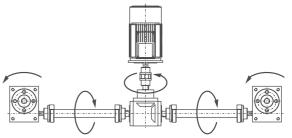







 $f_{s} = 4.4$ 

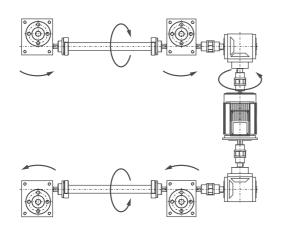




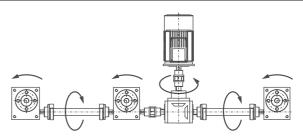

f<sub>s</sub> = 4.6

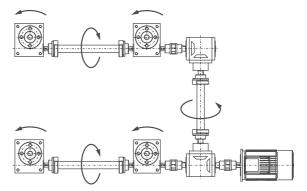



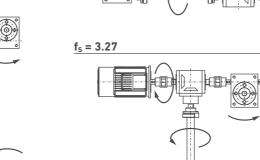






## Screw jacks ACCESORIES

MOTOR BELL SMB



The standard drive of Screw jacks is made using asynchronous AC motors. The following table shows the available motor flanges (IEC type and size) for each screw jack size. For other types/sizes of motors, please contact NIASA. We can supply adapters for any kind of electrical motor (AC single phase, AC with integrated inverter, DC, BLDC, stepper, ...).


Ensure motor is not overdimensioned for the selected screw jack size. It may cause damage, or even breakage, of it. For powers higher than the indicated ones in the next table, contact NIASA.

Screw jack size	Motor flange (IEC type	(k Op	wer W) tion	ØA (mm)	ØB (mm)	ØC (mm)	Bell <sup>1)</sup> D (mm)	Ød <sup>2)</sup> (mm)	L <sub>1</sub> (mm)	Weight (kg)				
	& size)	Α	В											
	56 B5	0,06	0,09	120	100	80	Ø6,5	9	61	0,7	SMB	- M3	- 71 B5	- IN
M1	63 B14B 71 B14B	0,12 0,25	0,18 0,37	120 140	100 115	80 95	Ø6,5 Ø9	11 14	61 68	0,7 1		Screw	Motor	Application
	63 B5	0,23	0,37	140	115	95	Ø9	14	76	1,1		jack	flange	IN Indoor
M2	71 B14B	0,25	0,37	140	115	95	ø9	14	76	1,1		size		OU Outdoor
	80 B14B	0,55	0,75	160	130	110	ø9	19	84	1,4				SP Special
	71 B5	0,25	0,37	160	130	110	Ø9	14	103	1,8				category to
M3	80 B14B	0,55	0,75	160	130	110	Ø9	19	103	1,8				ISO 12944
IVIS	90 B14B	1,1	1,5	160	130	110	Ø9	24	123	2,4				
	100 B14A	2,2	3	160	130	110	Ø9	28	123	2,4				
	71 B5	0,25	0,37	160	130	110	M8	14	128	2,7				
	80 B5	0,55	0,75	200	165	130	Ø11	19	128	3,2				
M4	90 B5 100 B14B	1,1 2,2	1,5 3	200 200	165 165	130 130	Ø11 Ø11	24 28	128 128	3,7				
	100 B14B 112 B14B	2,2 4	5	200	165	130	Ø11 Ø11	28	128	3,7 3,5				
	80 B5	0,55	0,75	200	165	130	M10	19	173	6,3				
	90 B5	1,1	1,5	200	165	130	M10	24	173	6,3				
M5	100 B5	2,2	3	250	215	180	Ø13,5	28	171	7,4				
	112 B5	4		250	215	180	Ø13,5	28	171	7,4				
	132 B14B	5,5	7,5	250	215	180	Ø13,5	38	171	7,4				
	90 B5	1,1	1,5	200	165	130	M10	24	173	6,3				
	100 B5	2,2	3	250	215	180	Ø13,5	28	171	7,5				
J1	112 B5	_4		250	215	180	Ø13,5	28	171	7,5				
	132 B14B	5,5	7,5	250	215	180	Ø13,5	38	171	7,5				
	160 B14A	11	15	250	215	180	Ø13,5	42	201	9,6				
	90 B5 100 B5	1,1	1,5 3	200 250	165 215	130 180	M10 Ø13,5	24 28	194 203	7,4				
	100 BS 112 B5	2,2 4	5	250	215	180	Ø13,5	28 28	203	9,1 9,1				
J3	132 B14B	4 5,5	7,5	250	215	180	Ø13,5	20 38	203	9,1 9,1				
	160 B14A	3,5 11	15	250	215	180	Ø13,5	42	203	10,3				
	180 B5	18,5	22	350	300	250	Ø17,5	48	203	13,5				
							. ,-							

#### DIMENSIONS AND WEIGHTS

<sup>1)</sup> It includes coupling and fasteners to fix motor

<sup>2)</sup> Coupling key way according to DIN 6885

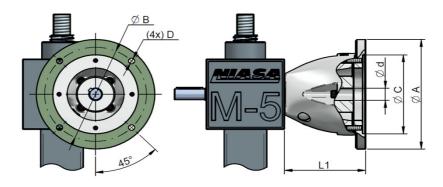

#### MATERIALS AND SURFACE TREATMENTS

Bell (aluminium): Fastenings: Indoor applications <sup>1)</sup> Anodizing ( $8^{12} \pi m$ ) Black oxide coating Outdoor applications <sup>2)</sup> Anodizing (15~20  $\pi$ m) Stainless steel

<sup>1)</sup> Approx. C2-Medium durability (ISO 12944).
 <sup>2)</sup> Approx. C3-Medium durability (ISO 12944).
 Special coatings on request, until C5 (ISO 12944)




# MAXIMUM TRANSFERABLE TORQUE DEPENDING ON SHAFT/ PARALLEL COTTER PIN (DIN 6885)

The following table shows the maximum transferable torque for a shaft and its keys. It is considered that the shaft is subject exclusively to torsional forces.

#### IMPORTANT

... Never apply to the input shaft of a screw jack torques over those indicated for its shaft and keys (see plans in the sub-chapter "sizes").

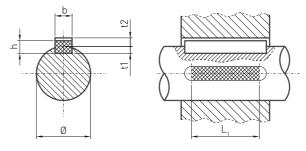

Shaft diameter	Ke	Maximum transferable torque, M <sub>D</sub> (Nm) Key effective length, L <sub>1</sub> (mm)								
Ø (mm)	b x h (mm)	t1 (mm)	t2 (mm)	10	16	20	28	40	50	70
8 - 10	3 x 3	1.8	1.4	5	9	12	-	-	-	-
10 – 12	4 x 4	2.5	1.8	9	13	17	-	-	-	-
12 – 17	5 x 5	3	2.3	15	24	30	42	-	-	-
17 – 22	6 x 6	3.5	2.8	25	40	50	70	100	-	-
22 - 30	8 x 7	4	3.3	39	63	78	109	157	195	-
30 – 38	10 x 8	5	3.3	50	82	102	143	204	255	357
38 - 44	12 x 8	5	3.3	62	98	123	173	247	308	432
44 - 50	14 x 9	5.5	3.8	82	132	164	230	330	412	575

Material: C45 (1.1191) according to EN 10083-1 Load type: Drive - Uniform / Load - Light knocks Assembly: tight Cycles: >1,000,000 Safety factor: 1.5 - 2.5 IMPORTANT For other conditions, please contact the NIASA technical department

# Screw jacks



### **GEAR BOX LUBRICATION**

**Dacida** 

AUTORIZADO

When delivered the screw jacks gear boxes are ready to be operated. Complying with the next guidelines is essential to ensure that they will run properly along their life and will reach the expected one.


DISTRIBUIDOR MEX (55) 53 63 23 31 MTY (81) 83 54 10 18

QRO (442) 1 95 72 60 ventas@industrialmagza.com

#### **"W" GEAR BOX LUBRICATION**

The bronze wheel of "W configuration - Trapezoidal screw" has several through radial holes, that allow the grease of the gear box to lubricate directly onto the screw thread when traveling across it. Thereby, the screw is greased too.


Because of this reason the gear box must be periodically re-filled with new grease. In general, at 25-50 service hours after the commisioning and then every 200-300



#### RE-GREASING<sup>1)</sup>

 > After commisioning: At 25-50 operation hours
 > Periodically: Every 200-300 operation hours (or 1 year, whichever comes first)


The ball screw of "W configuration gear box" does not take grease from it. In general, lubricating the gear box every 400-600 operation hours is enough.




<u>RE-GREASING <sup>1)</sup></u> > Every 400-600 operation hours (or 2 years, whichever comes first)

#### **CLEANING AND GREASE CHANGE**

For both gear box configurations, "W" and "R", in general, every 800-1200 operation hours, we recommend an internal complete cleaning of it to remove oldgrease and re-lubricate with new one.






#### **"R" GEAR BOX LUBRICATION**

The screw of "R configuration gear box" does not take grease from it. In general, lubricating the gear box every 400-600 operation hours is enough.





These times must be varied, depending on the duty cycle, ambient temperature, speeds, loads, mounting position, etc. Begin with a high inspection frequency until knowing the real requirements for the application.

Avoid over-greasing the gear box. Pump grease only until it begins to get out through the sealing system between the gear box top cover and the screw. Excessive grease may cause an abnormal over-heating of the worm-gear.



This time may vary, depending on the duty cycle, ambient temperature, speeds, loads, etc. Periodic grease analysis will determine if its change must be done sooner.

See our Instruction Manual (procedure, grease amount, etc) before carrying this operation out.





#### STANDARD GREASE

As standard, the screw jacks gear boxes are supplied with the following grease or an equivalent one. See on manufacturer Website for further information about it.



**DIVINOL LITHOGREASE G421** 

High quality, semi-synthetic lithium complex soap grease

Colour / Appearance Operating temperature range -	yellow 35°C - +160°C
NLGI-class / DIN 51 818	2
Base oil viscosity / 40°C / DIN 51 562	130 mm²/s
Dropping point / DIN ISO 2176	> 220 °C
Worked penetr. / 0,1 mm DIN ISO 2137	280-300
Water resistance / DIN 51807-1	Eval. level 1
Corrosion protec. (EMCOR-test) / DIN 51 802	0/0

Before using greases different to the previous one, ensure they have similar properties. Contact us in case of doubt.

Mix only compatible greases. Mixing noncompatible greases will lead to an ineffective lubrication, reducing the screw jack performances and could even damage the gear box.


#### **GREASING POINTS**

To re-grease the gear box, the screw jacks are supplied with a greasing plug of brass with O-ring (thread M  $10\exists$ 1).

Optionally, it is replaced by a MT-506 / 45° / DIN 71412 grease nipple with a spring valve (max. pumping pressure 550 bars). It allows maintenance personnel to use a lubrication pump.



The gear box greasing points must be always accesible while the screw jack is operating.

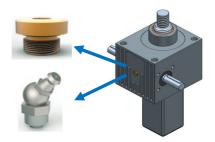

#### SPECIAL GREASES

For applications in extreme environmental conditions (very high or very low temperatures) or with special requirements (e.g. for food industry), let us know them and we will select the most suitable lubrication for the case.

#### HIGH PERFORMANCE GREASE

NEW

On request, we can offer you a new design of completely sealed gear boxes ("W" and "R" configurations). They incorporate a high performance fluid grease (see below its main data), with an excellent behaviour under demanding duty cycles. See on manufacturer Website for further information about it.


This innovative gear box desig does not require any re-greasing operation. It is advisable analizing the grease status every 800-1200 operation hours. Only if it showed degradation signs, remove the old grease and re-lubricate with new one, after an internal complete cleaning of the gear box.



**DIVINOL LITHOGREASE 00** 

High grade, semi-synthetic lithium complex soap grease

Colour / Appearance yellow Operating temperature range -30°C - +150°C NLGI-class / DIN 51 818 00 Base oil viscosity /40°C / DIN 51 562 200 mm<sup>2</sup>/s Dropping point / DIN ISO 2176 > 180 °C Worked penetr. /0,1 mm DIN ISO 2137 415-430 Water resistance / DIN 51807-1 Eval. level 1 Corrosion protec. (EMCOR-test) / DIN 51 802 0/0



RE-GREASING > No CLEANING AND GREASE CHANGE, ONLY IF GREASE WITH DEGRADATION SIGNS<sup>1)</sup> > Analyze grease status every 800-1200 oper. hrs (or 5 years, whichever comes first)



This time may vary, depending on the duty cycle, ambient temperature, speeds, loads, etc. Periodic grease analysis will determine if its change must be done sooner.

See our Instruction Manual (procedure, grease amount, etc) before carrying this operation out.



\i\



## **Screw jacks** LUBRICATION



### SCREW LUBRICATION

Screws should never run dry (nevertheless, if they are unprotected from a dirt environment, it is preferable not to keep a big amount of grease on them). The lubricant absence increases the heat generation, idle torque and eventually noise level, while reduces dramatically the service life. Comply with the next guidelines to ensure that they will run smoothly along their life and will reach the expected one.

Before greasing screws (no when re-greasing), it is advisable cleaning them carefully to remove the old grease and contamination particles.

The lubrication frequency depends on the operating conditions. Consider the following ones only as an orientation. Begin with a high inspection frequency until knowing the real requirements for the application.

#### **TRAPEZOIDAL SCREW (Tr) LUBRICATION:** "W" AND "R" GEAR BOX CONFIGURATIONS

They must be always kept amply greased.

Re-grease the screw before commisioning, at 25-50 operation hours after it and then inspect the lubrication level periodically until determining the most adequate frequency for the application.

Clean of the old grease and lubricate with new one, when they notice it is dirty.



#### **RE-GREASING**

- > Before commisioning
- > After commisioning: At 25-50 operation hours
- > Periodically: When necessary to keep screw well lubricated

#### **CLEAN AND GREASING**

> Periodically: When necessary to keep screw clean (or 1 year, whichever comes first)

When lubricating, use a brush or similar until getting a generous film of lubricant along the screw (with it completely extended), without areas with grease accumulations.



#### SPECIAL GREASES

For applications in extreme environmental conditions (very high or very low temperatures) or with special requirements (e.g. for

food industry), let us know them and we will select the most suitable lubrication for the case (trapezoidal and ball screws).

#### **TRAPEZOIDAL SCREW (Tr) GREASE**

We recommend to use the following grease (see on manufacturer Website for further information about it), but any roller bearing grease with no solid lubricants can be used.



#### **DIVINOL LITHOGREASE G421**

High quality, semi-synthetic lithium complex soap grease

Colour / Appearance Operating temperature range -	yellow 35°C - +160°C
NLGI-class / DIN 51 818	2
Base oil viscosity / 40°C / DIN 51 562	130 mm²/s
Dropping point / DIN ISO 2176	> 220 °C
Worked penetr. / 0,1 mm DIN ISO 2137	280-300
Water resistance / DIN 51807-1	Eval. level 1
Corrosion protec. (EMCOR-test) / DIN 51 802	0/0



#### Do not mix greases with different saponification basis.



#### **BALL SCREW (KGS) LUBRICATION: GENERALITIES**

They must be always kept with a thin film of lubricant.

In general, re-grease the screw every 200 operation hours. Inspect the lubrication level periodically until determining the most adequate frequency for the application.

Clean of the old grease and lubricate with new one, when they notice it is dirty.

#### BALL SCREW (KGS) LUBRICATION: GREASE

We recommend to use the following grease (see on manufacturer Website for further information about it), but any roller bearing grease with no solid lubricants could be used too.



Do not mix greases with different saponification basis.


#### BALL SCREW (KGS) LUBRICATION: "W" GEAR BOX CONFIGURATION

When greasing/re-greasing, use a cloth soaked with grease until getting an uniform and thin film of lubricant along the screw (with it completely extended), without areas with grease accumulations.




#### LUBRICATION WHEN SHORT STROKES

When "W" configuration gear box, it is recommended not to select screw jacks which stroke is shorter than the gear box height, in order to ensure a right lubrication of the screw, doing periodically several complete strokes to grease it.

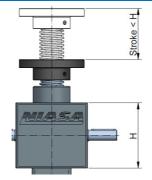


When "R" configuration gea box, if stroke is shorter that the nut length, contact us for a special design of its lubrication system, in order to ensure a right lubrication





Pay special attention to the lubrication of applications with short operation strokes (trapez. and ball screws).



#### **RE-GREASING**

> Periodically: Every 200 operation hours

#### CLEAN AND GREASING

> Periodically: When necessary to keep screw clean (or 1 year, whichever comes first)



#### **ISOFLEX TOPAS L 152**

Grease for roller bearings with synthetic base oil

Base oil viscosity /40°C / DIN 51 562 Dropping point / DIN ISO 2167 Worked penetr. / 0,1 mm DIN ISO 2137 Water resistance / DIN 51807-1	beige -50°C - +150°C 100 mm²/s >= 185 °C 265-295 <= 1-90
Corrosion protec. (EMCOR-test) / DIN 51 802	2 <= 1

BALL SCREW (KGS) LUBRICATION: "R" GEAR BOX CONFIGURATION

When greasing/re-greasing, do it with through the greasing point of the nut with approx. 1 ml grease per 10 mm screw diameter (e.g. 5 ml for a KGS dia. 50).





Do not over-grease the nut to avoid an excessive heating when running. Contact us for a precise estimation of grease amount.



## PROTECTION AGAINST CORROSION, SEALING AND AMBIENT TEMPERATURE

#### PROTECTION AGAINST CORROSION

Select the environment in which the equipment will work, using the atmospheric corrosion categories classification established in the DIN EN ISO 12944-2 standard (protection against the corrosion of steel structures using painted systems). Also establish the durability required before carrying out the first maintenance of the exterior surfaces (durability does not imply a "time" guarantee).

If the corrosion category is higher than "C3" for your application and/or higher than "average" durability is required, please contact NIASA so that the technical department can select the surface protection system and select the most suitable components.

#### PROTECTION AGAINST THE INPUT OF SOLIDS AND LIQUIDS

NIASA screw jacks offer, as standard, an IP54 protection index to prevent solid and liquid particles from entering the inside, which may damage them or reduce their designed service life.

Use the following table, according to the DIN EN IEC 60529 standard, if the level of protection must be higher than that indicated. NIASA supplies, on request, specially designed units to withstand the most aggressive environments.

The protection levels are defined with a code made up of the letters "IP" and two numbers "XY".

LEVEL OF PROTECTION "IP", AGAINST THE INPUT OF ...

CORRO	SION	ENVIRC	INMENT
CATEG	ORY	Outdoors	Indoors
C1	Very low		Buildings with heating and clean atmospheres.
C2	Low	Atmospheres with low levels of pollution. Rural areas.	Buildings with no heating and possible condensation.
C3	Medium	Urban and industrial atmospheres, with moderate SO <sub>2</sub> pollution. Coastal areas with low salinity.	Manufacturing plants with high humidity and some pollution.
C4	High	Industrial areas and coastal areas with moderate salinity.	Chemical and swimming pool industries.
C5-I	Very high (industrial)	Industrial areas with high humidity and aggressive atmosphere.	Buildings or areas with almost permanent condensation and high contamination.
C5-M	Very high (maritime)	Coastal and maritime areas with high salinity.	Buildings or areas with permanent condensation and high contamination.

		DURABILITY
LOW	L	2 to 5 years
MEDIUM	М	5 to 15 years
HIGH	Н	More than 15 years

	solid particles: "X"	liquids: "Y"				
5	Protection against dust residues (the dust that may penetrate the inside does not imply incorrect operation of the equipment).	3	Protection against spray water (from angle up to 60° with vertical).			
6	Total protection against the penetration of any kind of solid body (sealing).		Protection against water splashes (from any direction).			
		5	Protection against water streams from any direction with hose.			
		6	Protection against sporadic floods (example: tidal wave).			

#### AMBIENT TEMPERATURE

Contact NIASA if your unit will be installed in an environment that may reach temperatures below -20°C.

NIASA's technical department will prescribe the most suitable materials and sealing components for the specific conditions of the application. Also do this

if ambient temperatures over 40°C are expected.



## **OPTIONAL CONFIGURATIONS**

Optionally, NIASA may adapt your screw jack, modifying the different parts of it to your preferences.

Some examples are shown below. See sub-chapter "Placing an order".

#### Immobilizations

Configuration N with anti-rotating screw using a pin on the upper cover and a groove on the screw. This configuration is only available for trapezoidal screws and on small strokes. For further information please contact NIASA.



#### Screw end

- **0.** With no end.
- **G.** With standard thread.
- **Z.** Standard cylindrical end.
- S. Special end.



#### Special configurations

On request, screws with various inputs can be supplied to obtain higher, but eventually reversible, travel speeds. The screw jacks can also be supplied with left-thread screws.



There is a possibility, at the customer's request, to supply the screw jacks with one of the sides of the worm shaft cut.



One Two Three Four inputs

## MASA



# **SCREW JACKS PLACING AN ORDER**


02       N       Screw travel without immobilization W Screw travel without immobilization R Nut travel         03       Screw travel immobilized in rotation R Nut travel         03       GEARBOX S Normal speed H Slow speed         04       EQUIPMENT GENERAL PROTECTION IPS Standard IP protection level IPS Special IP protection level IPS Special IP protection level KGF1 Ball nut with flange KGM1 Smooth ball nut KGM2 Double ball nut with "preload system" flange KGM1 Smooth ball nut KGM2 Double ball nut with "preload system" flange KGM1 Smooth ball nut With trapezoidal stainless steel KGS Ball         06       STROKE OD00 Equipment usable stroke in mm         07       SCREW END Configuration R Z Standard threaded end Configuration RW G Standard threaded end Configuration R/N/W S Special end 0 With no end         10       NUT ACCESSORY (ONLY CONFIGURATION R) KAS Special nut flange 000 No accessory on nut         11       BOX FASTENING ACCESSORY Configuration R HFM Gearbox fastening fork (only fastening possibility on the back)         8       Special end 0 With no end         11       BOX FASTENING ACCESSORY Configuration R HFM Gearbox fastening fork (only fastening possibility on the back)         8       Special end 0 With no end	01	SIZE M1 M2 M3 M4 M5 J1 J3 J4 J5			08	Config BPS GKS GKB GIR Config BPR	V FASTENING uration N/W Flange Single fork Double fork Ball joint uration R Screw flange uration R/N/V	with bearing		
03       GEARBOX         03       S       Normal speed         103       S       Normal speed         104       EQUIPMENT GENERAL PROTECTION         105       Standard IP protection level         105       SCREW TYPE (DIAMETER x PITCH)         105       SCREW TYPE (DIAMETER x PITCH)         106       STROKE         0000       Equipment usable stroke in mm         07       SCREW END         Configuration R       Z         2       Standard threaded end         Configuration R/N/W       G         2       Standard threaded end         11       BOX FASTENING ACCESSORY         2       Standard threaded end         0       With no end	02	<ul><li>N Screw travel v</li><li>W Screw travel in</li></ul>			09	000 NUT TY	No accessory	NFIGURATIO	)N R)	
04       EQUIPMENT GENERAL PROTECTION IPS Standard IP protection level IPS Special IP protection level         05       SCREW TYPE (DIAMETER x PITCH) TRS Trapezoidal TRX Trapezoidal stainless steel KGS Ball         06       STROKE 0000 Equipment usable stroke in mm         07       SCREW END Configuration R Z Standard cylindrical end         08       STROKE 0000 Kapping         09       STROKE 0000 Configuration R Z Standard threaded end         11       BOX FASTENING ACCESSORY Configuration R/N/W S Special end 0 With no end         11       Box FASTENING ACCESSORY Configuration R/N/W S Special end 0 With no end         11       BOX FASTENING ACCESSORY Configuration R/N/W S Special end 0 With no end	03	S Normal speed				EFM1 EFM2 EFMS	Single nut wi Double nut Nut with safe	th flange		
05       SCREW TYPE (DIAMETER x PITCH) TRS Trapezoidal TRX Trapezoidal stainless steel KGS Ball       KGM2 Double ball nut with "preload system" KGMF Ball nut with flange +smooth ball nut "preload system"         06       STROKE 0000 Equipment usable stroke in mm       10       NUT ACCESSORY (ONLY CONFIGURATION R) KAR Nut flange with trunnion mounts KAS Special nut flange 000 No accessory on nut         07       SCREW END Configuration R Z       10       NUT ACCESSORY (ONLY CONFIGURATION R) KAR Nut flange with trunnion mounts KAS Special nut flange 000 No accessory on nut         11       BOX FASTENING ACCESSORY Configuration R/N/W S       11         5       Special end 0       With no end         11       BOX FASTENING ACCESSORY Configuration R HFM Gearbox fastening fork (only fastening possibility on the back)         12       R/N/W configurations LCM Gearbox mounting feet ZKM Flanges ZK gearbox fastening with botts ZKY Flanges ZK gearbox fastening with botts ZKY Flanges ZK gearbox fastening with 90° botts FMS Special box fastening	04	IPS Standard IP pr	rotection level	N		KGF1 KGF2	Ball nut with Double ball n flange	ut with "prel	oad system	ı"
06       STROKE 0000       Equipment usable stroke in mm         07       SCREW END Configuration R Z       10       NUT ACCESSORY (ONLY CONFIGURATION R) KAR         10       KAR       Nut flange with trunnion mounts         KAS       Special nut flange       000         000       No accessory on nut       11         BOX FASTENING ACCESSORY       Configuration R/N/W         G       Standard threaded end         Configuration R/N/W       S         S       Special end         0       With no end         LCM       Gearbox fastening fork (only fastening possibility on the back)         R/N/W configurations       LCM         LCM       Gearbox fastening with bolts         ZKH       Flanges ZK gearbox fastening with bolts         ZKV       Flanges ZK gearbox fastening with 90° bolts         FMS       Special box fastening         000       No accessory	05	<b>TRS</b> Trapezoidal <b>TRX</b> Trapezoidal st		)		KGM2	Double ball n Ball nut with	ut with "prel flange +smo		
07       SCREW END Configuration R Z       10       KAR       Nut flange with trunnion mounts         2       Standard cylindrical end       000       No accessory on nut         11       BOX FASTENING ACCESSORY G       Standard threaded end         11       BOX FASTENING ACCESSORY Configuration R/N/W S       Special end 0         0       With no end       Image: No end         12       R/N/W configurations LCM       Gearbox fastening fork (only fastening possibility on the back)         11       R/N/W configurations LCM       Gearbox mounting feet ZKM         2KH       Flanges ZK gearbox fastening with bolts ZKH       Flanges ZK gearbox fastening with bearings ZKY         000       No accessory	- 06		usable stroke in	mm			-	ball screw		
G       Standard threaded end         Configuration R/N/W       S         S       Special end         0       With no end         LCM       Gearbox fastening fork (only fastening possibility on the back)         R/N/W configurations         LCM       Gearbox mounting feet         ZKM       Flanges ZK gearbox fastening with bolts         ZKH       Flanges ZK gearbox fastening with bearings         ZKV       Flanges ZK gearbox fastening with 90° bolts         FMS       Special box fastening         000       No accessory	07	Configuration R	ndrical end		10	KAR KAS	Nut flange wi Special nut fl	th trunnion r ange		)
0 With no end R/N/W configurations LCM Gearbox mounting feet ZKM Flanges ZK gearbox fastening with bolts ZKH Flanges ZK gearbox fastening with bearings ZKV Flanges ZK gearbox fastening with 90° bolts FMS Special box fastening 000 No accessory	-	G Standard three Configuration R/N/	aded end		11	Config	<b>uration R</b> Gearbox faste	ening fork (o	nly fastenir	ıg
Example 01 02 03 04 05 06 07 08 09 10 11						LCM ZKM ZKH ZKV FMS	Gearbox mou Flanges ZK g Flanges ZK g Flanges ZK g Special box fa	nting feet earbox faste earbox faste earbox faste astening	ning with b	earings
M3 R H IPS TRS3006 1000 Z BPS EFM01 KAR LCM	Examp									

MAGZA DIS AU

12 01 02 13 58 00 14 00 14 00 FC FC 00 15 15 FF FR 00 16 55 FF 00 17 MF MS VE 00	No tip support MIT SWITCH ACCES NLY N/W CONFIGUE M Mechanical limit I Inductive limit sv G Magnetic limit sv I No limit switche MIT SWITCH ASSEM NLY APPLICABLE T Fixed limit switc Adjustable limit REW PROTECTION Bellow type prot Spiral metallic p No protector RIVE ADAPTATION K Standard flange S Special adaptati Wheel	op of the gear eath the gearb SORY RATIONS) switches witches switches switches SWILY TYPE TO FCM/FCI) hes switches ACCESSORY ector rotector	ox		080 Gr A Pc 0000 Nd 1111 Nd WORM SH A Side B Side 0 Both WORM SH PR With 00 No p UBRICAI GRA Stan GRX Lubr GRS Othe LUBRICAI EMT Angl ETP Seal AGR Auto 000 No lu EQUIPME RGG Grap RAZ Blue RGP Silve RSP Spec CIP Only 000 Not	A end suppres A end suppres B end suppres a sides maintain <b>HAFT PROTECT</b> protector orotector <b>NT</b> Indard lubricant ricant for low ere er lubrication com led grease nipp led lubrication com atic lubrication	er-2 otor sed sed ned <b>TON ACCES</b> <b>TON ACCES</b> <b>Ion ACCES</b> (context) (context	SORY peratures d) ry ard)
<b>12</b> 02	13         14           SB         FCI	<b>15 16</b> FF FB	<u>17</u> МК	<b>18 19</b> A GR08		<b>21</b> PR	<b>22</b> GRA	<b>23 24</b> AGR RGG



# **SCREW JACKS** N / W CONFIGURATION DISASSEMBLED

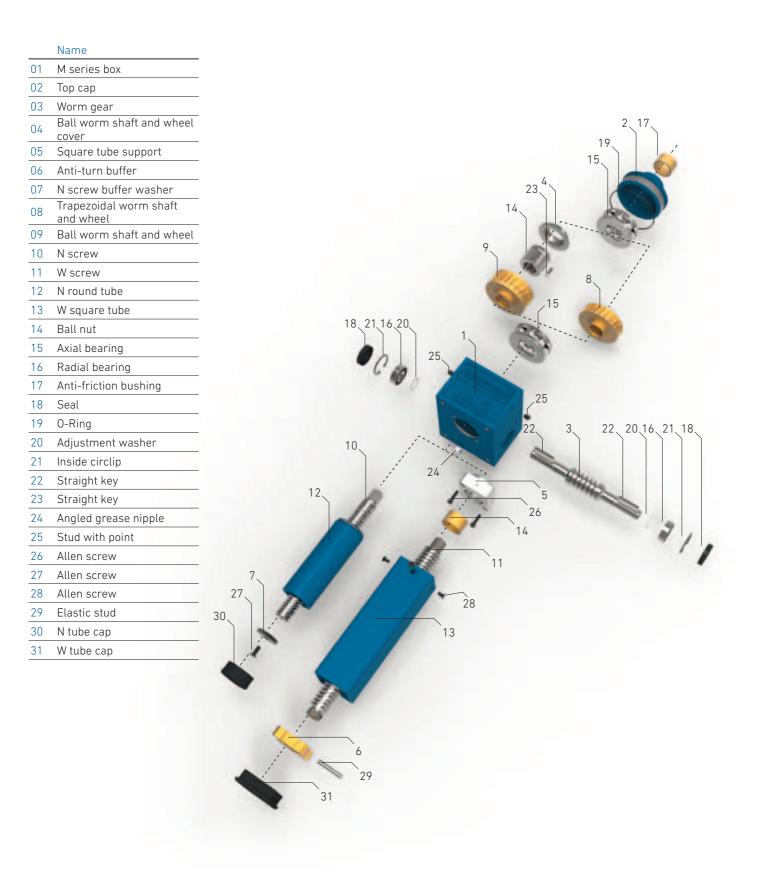






## **SCREW JACKS** R CONFIGURATION DISASSEMBLED



#### Name

01	M series box
02	Тор сар
03	Worm gear
04	Rear cap
05	Screw nut
06	Screw locknut
07	Worm wheel
80	Trapezoidal screw
09	Trapezoidal nut
10	Ball screw
11	Ball nut
12	Axial bearing
13	Radial bearing
14	Anti-friction bushing
15	Seal
16	O-Ring
17	Adjustment washer
18	Inside circlip
19	Straight key
20	Angled grease nipple
21	Stud with point
22	Allen screw
23	Straight key

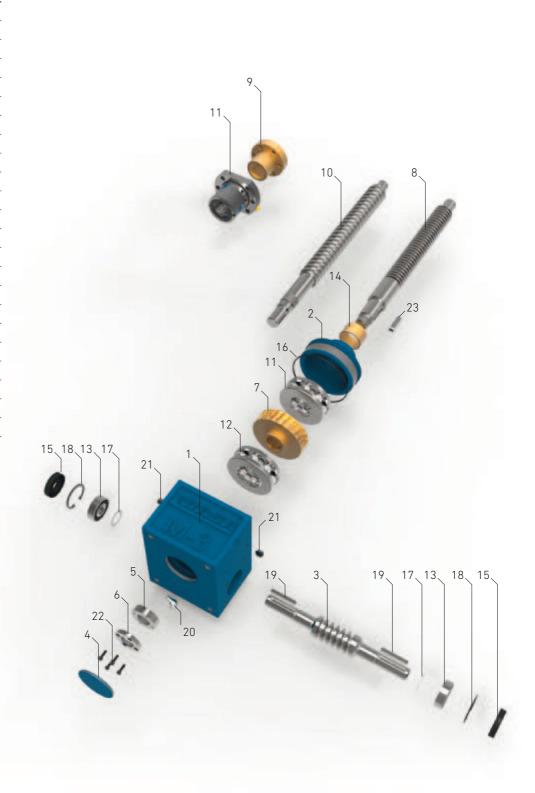



# **SCREW JACKS** SPECIAL CONFIGURATIONS

If the standard product range does not meet your requirements, please contact NIASA for customizing to any unit. Most probably it will be adapted to your requirements.

